

SERVICE BULLETIN

AMATEUR RADIO

SUBJECT

TS-940S SIGNAL TO NOISE RATIO IMPROVEMENT

DATE

8-28-86

The following change will reduce the tendency of the Zener Diode in the Noise Blanker circuit to cause an increase in the ambient noise level. This change ensures that no current flows thru this diode in the normal receive position.



Parts required

560 ohm 1/4 watt resistorRD14CB2E561J

Procedure:

On the IF UNIT (X48-1430-00) change R23 from 330 ohms to 560 ohms.

This change will be incorporated in all models beginning with serial number 603XXXX.

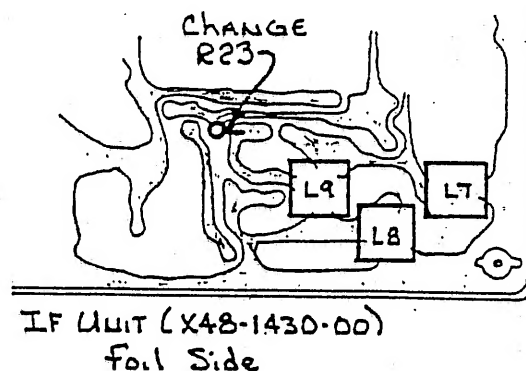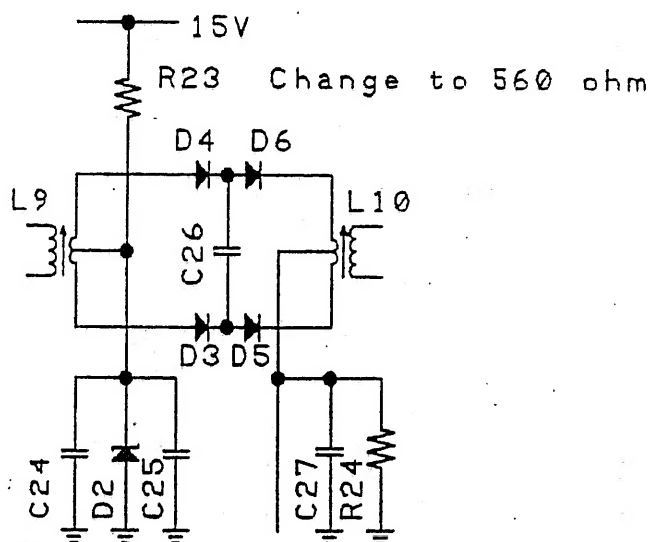

IF UNIT (X48-1430-00)

Time required for this modification is 1 hour or less. (C)82086TKCLM

TRIO-KENWOOD COMMUNICATIONS

1111 WEST WALNUT STREET • COMPTON, CALIFORNIA 90220 U.S.A.
MAILING: P.O. BOX 7065 • COMPTON, CALIFORNIA 90224
TELEPHONE: (213) 639-9000 SERVICE TELEPHONE: (213) 639-7140